

DATE 10/28/81

## SSC Service Bulletin

no. 81-217


TO: ALL REGENCY COMMUNICATIONS PROFESSIONAL SALES & SERVICE CENTERS  
ALL REGENCY COMMUNICATIONS PROFESSIONAL SALES REPRESENTATIVES

MODELS AFFECTED: MCU 34, 34H, MCU 18, 18H,  
MCBU 35A, 35B, MCBU 19A, 19B

PROBLEM: TRANSMITTER FREQUENCY DRIFTS RAPIDLY WHEN KEYED  
OR ERRATIC FREQUENCY READINGS WHEN NETTING CRYSTALS  
ON FREQUENCY

### SOLUTION:

Change R307 from 470 to 680 ohms - P/N 4700-0681-042

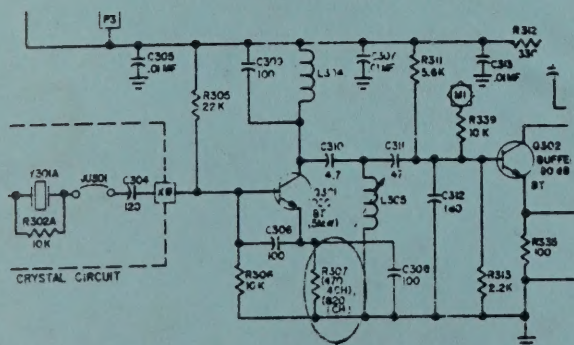

R307

1 CHAN: 820  $\Omega$

4 CHAN: 680  $\Omega$

TECHNICAL SERVICE DEPARTMENT

REGENCY COMMUNICATIONS, INC.



